

【 X431Remote Diagnose】 2014ShangHaiVW new POLO Fault Code“P106900—Collision cut have trigger \\'solve operation method.

Actual Measurement

ShangHai VW new POLO, 2014, VIN=LSVGZ26R3E20*****, pictures as follow.

The dashboard turned to system failure warning lights, system failures code "P106900 - collision cutoff has been triggered".



Note:

- 1.Switch on the ignition;
- 2.Keep the battery voltage more than 12V;
3. X-431 should be performed in a good WiFi state, otherwise the diagnosis will be abnormal due to poor signal.

Operation Procedure

- 1.Select ShaiHai VW V21.61;
- 2.Select VW General System ;
- 3.Select system selection;
- 4.Select 44 Steering booster system, see as Pic1



pic1

5. Perform [read fault code] display "P106900 - collision cutoff has been triggered" as shown in figure 2, and the next step will be carried out when the fault code cannot be cleared.



pic2

6. 执行【安全登录】，输入”20103”，如图3所示，提示登陆成功后执行下一步；



pic3

7. Execute [system channel match], click the reset of all match values, as shown in figure 4.



pic4

8. Next, the reset status prompt of all the matching values is executed, as shown in figure 5,



pic5

9. After the success of the failure code, the power steering is restored to normal.



长按指纹“识别二维码”关注 [golo](#) 官微