

【 X431Actual Measurement】 2012 air conditioner system Long coding function of instructions

Actual Measurement


Tiguan, 2012, VIN=LSVUL25N5C21*****

Need do long coding function if occurring situation as follow:

1. Is similar to the control unit coding errors and version information for all the long code value is 0;
2. Replace the new module of electronic control unit.

operation procedure

1. Choose VW V27.76 above;
2. Choose system selection;
3. Choose 08 air-conditioner heating system;
4. Read the old air-conditioning ECU version information and record the long code: 0000001002, as shown in figure 1;

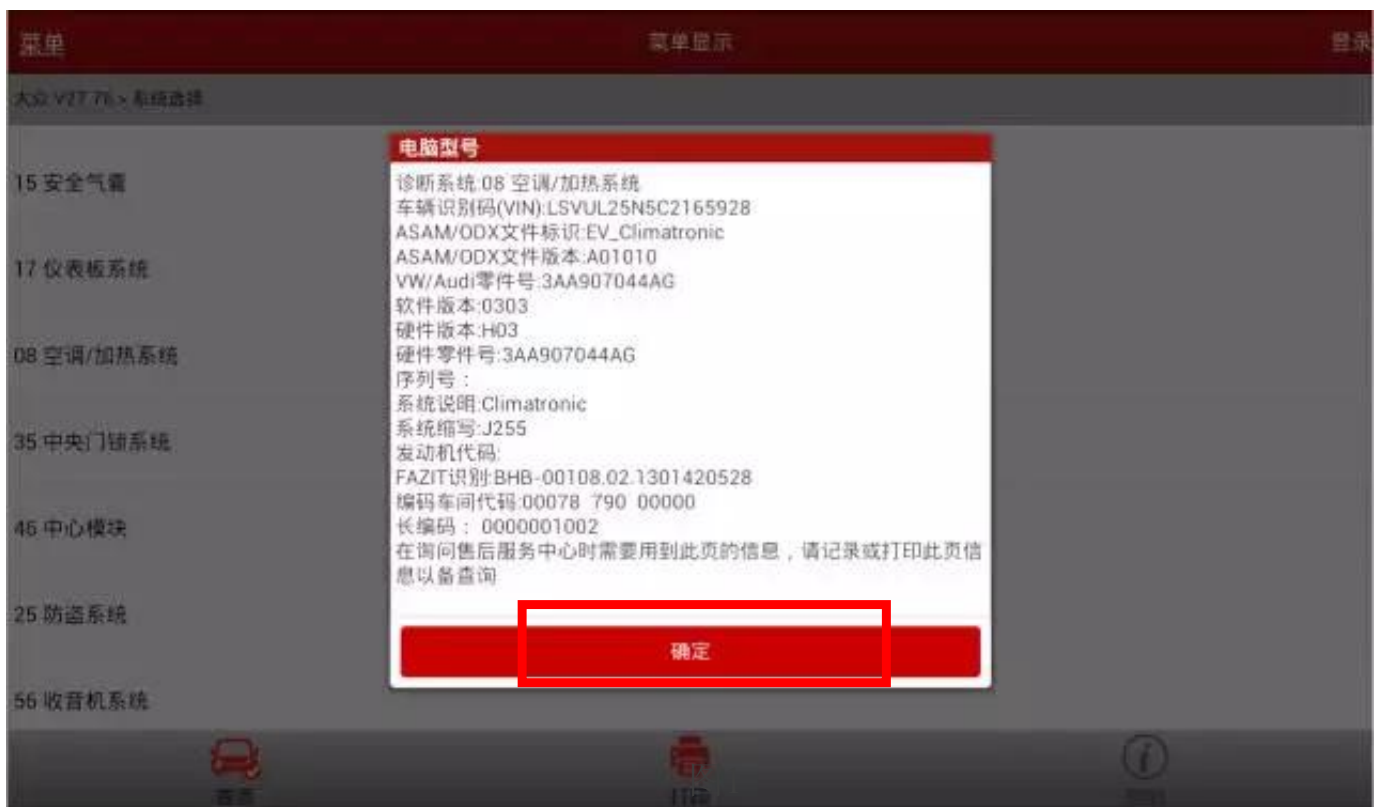


Pic1

5. Install the new air conditioner ECU, read the control unit version information, long code display all 0, indicating the need for long coding, as shown in figure 2;




图2

6. Choose [long coding], then choose [the hex code], as shown in figure 3;

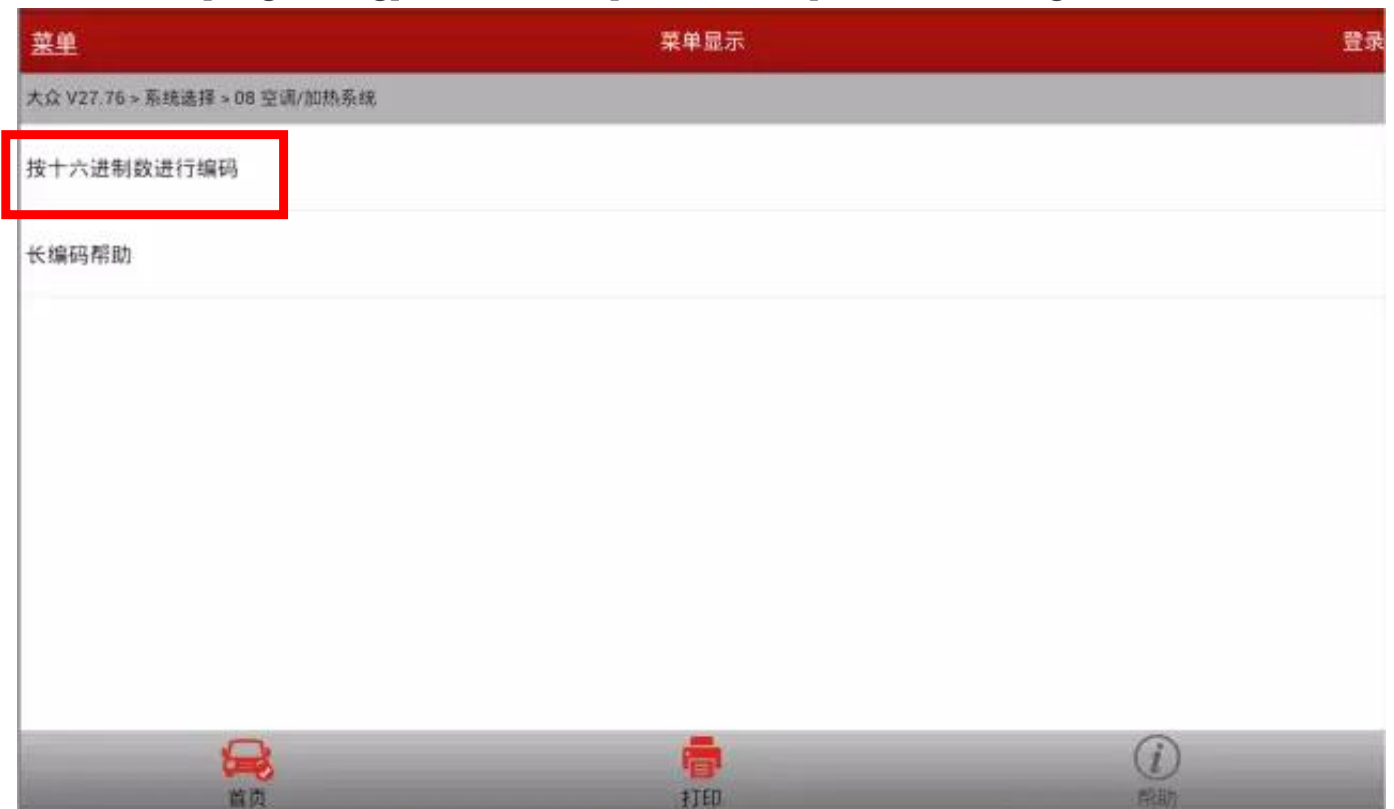


pic3

7. Prompts the current encoding, as shown in figure 4;

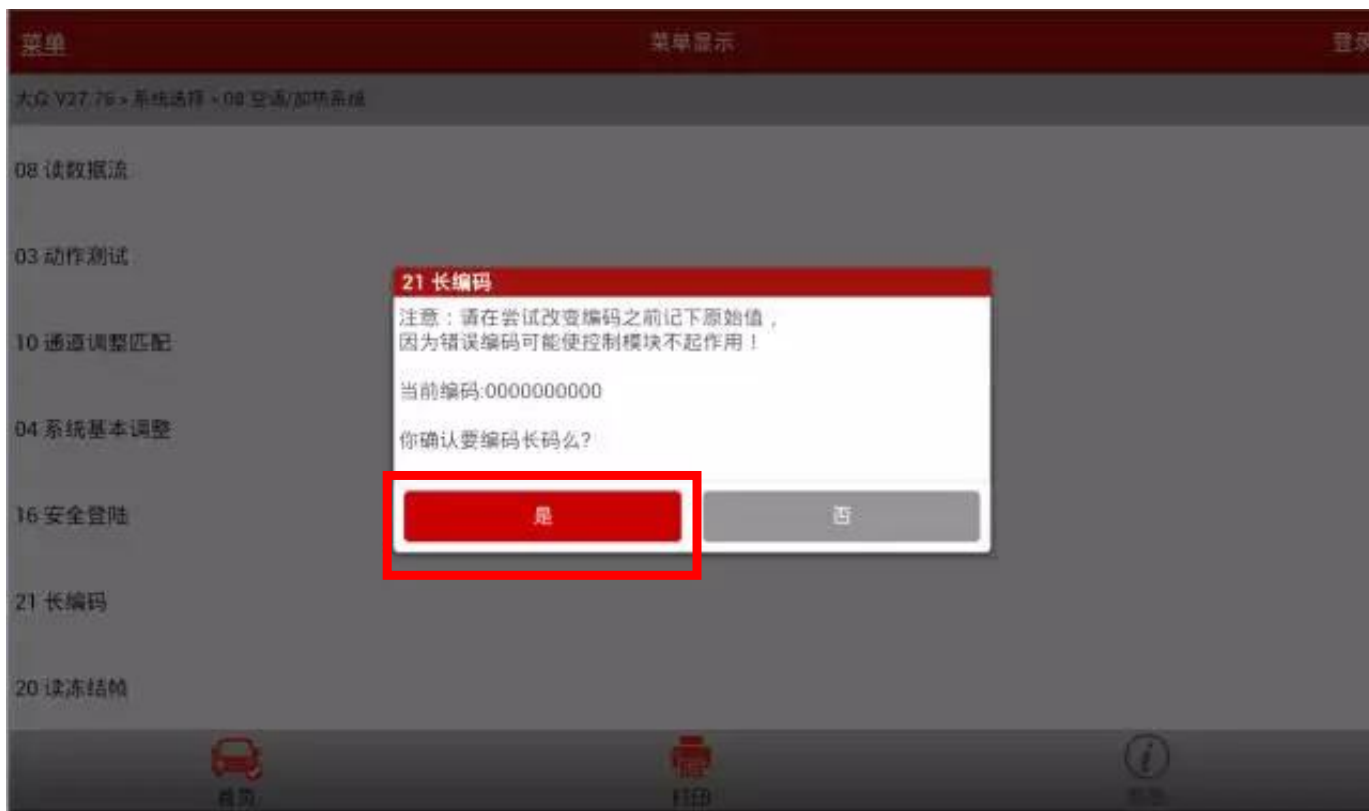


pic4

8. Click [yes] to enter the previous record in the new dialog box: 0000001002, as shown in

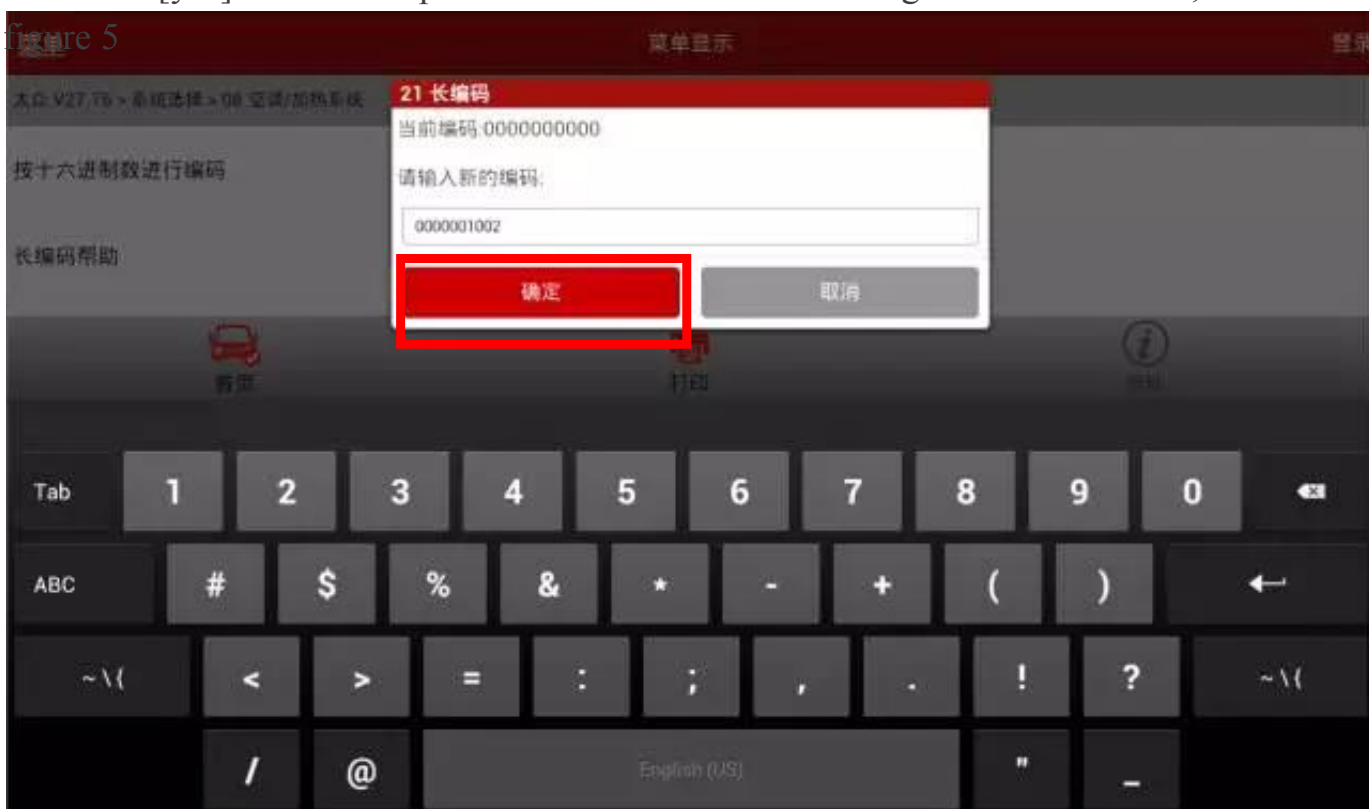


pic5

9. Click ok, the new dialog box that pops up prompts the old and new codes, as shown in figure 6;

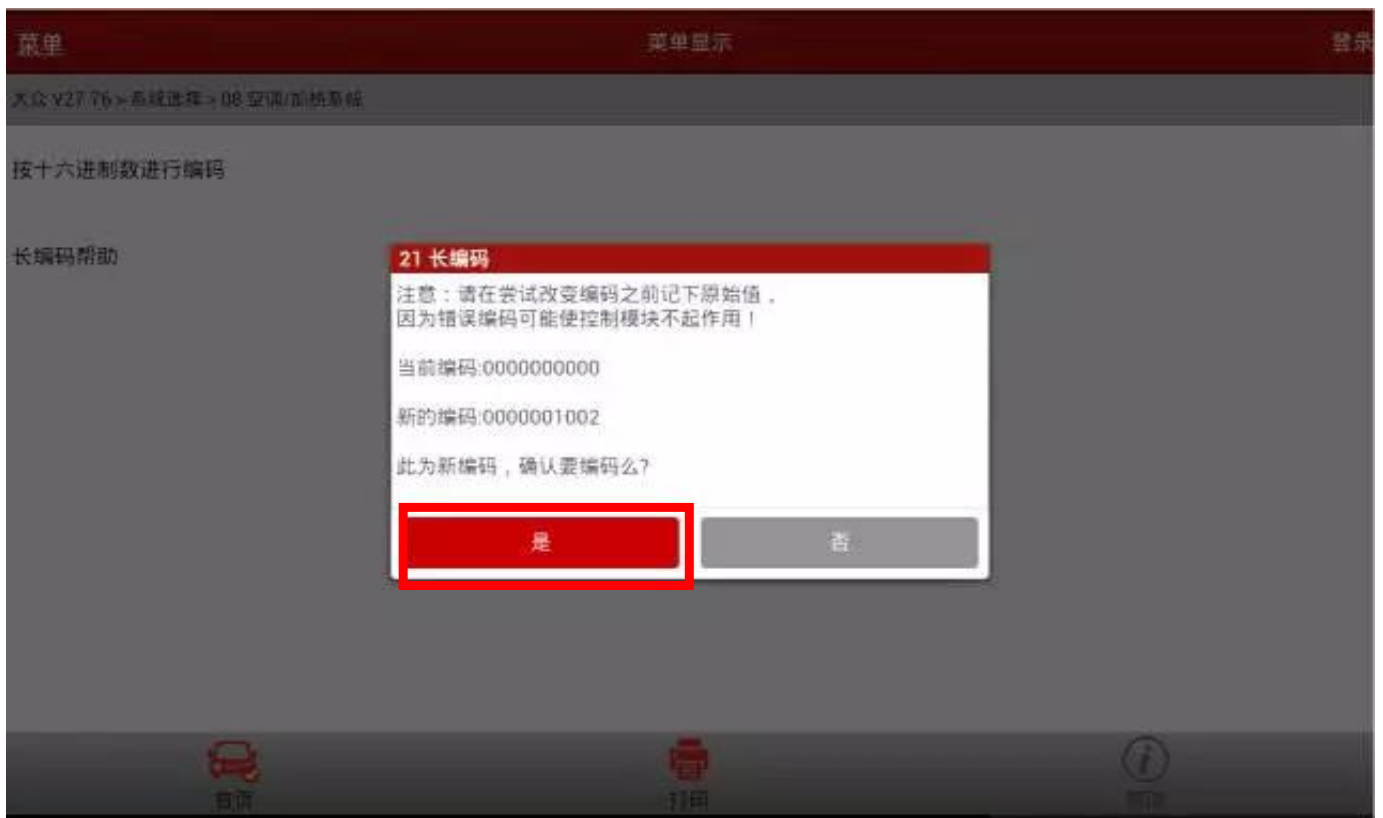

pic6

10. Click [yes], hint: code success, as shown 7;

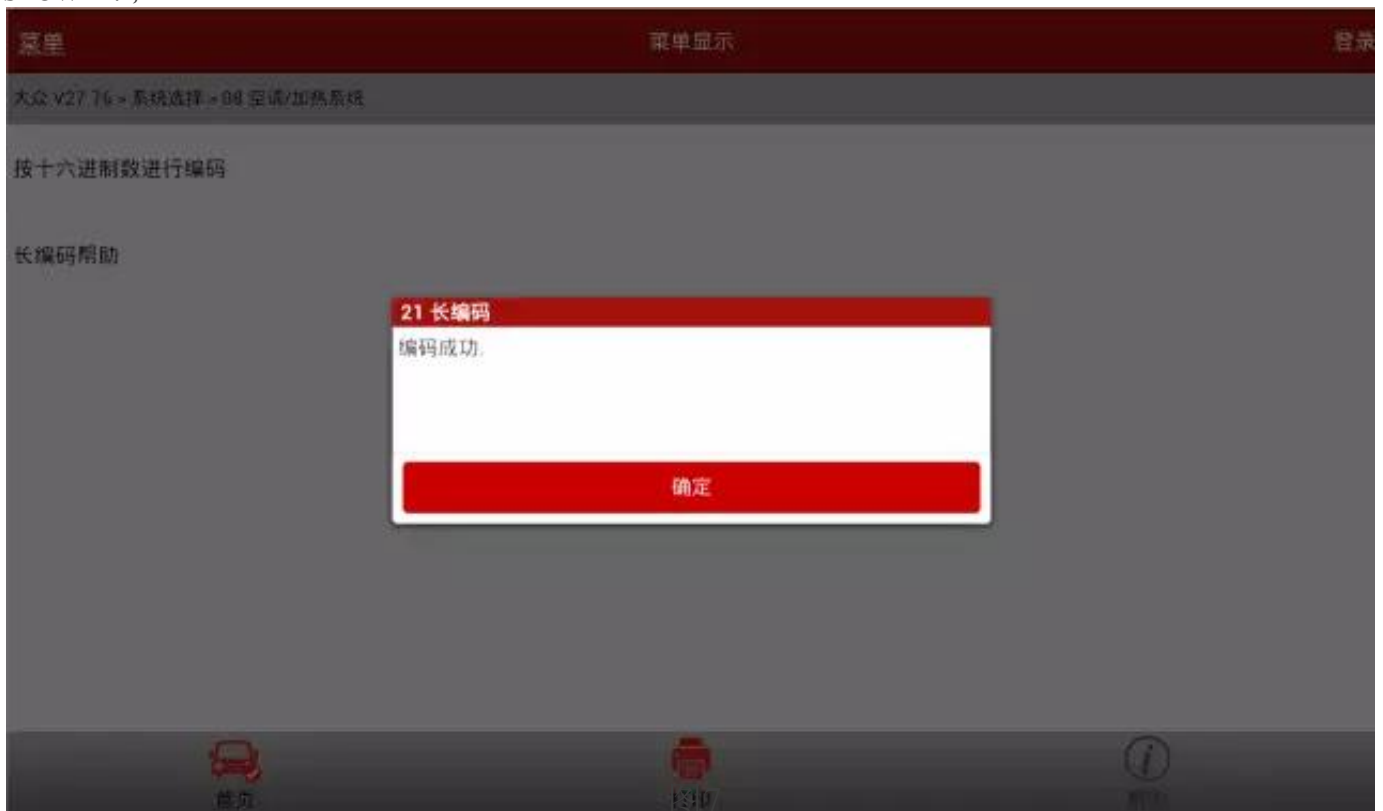

Pic7

11. Click [ok] to display the version information interface, where the code of the coding workshop and the long coding display data are not all 0, indicating long coding completion, as shown in figure 8;



pic8

12. After the match is completed, the fault code of the [read fault code] function should be selected. If the fault code is displayed, the long coding of the air conditioning system has been successfully completed.



长按指纹“识别二维码”关注 **golo** 官微