


Product model	Date	Number:
X-431 Pro series	20151201	—

**X-431 Pro Actual Measurement: Operation Method for Service Lamp Reset of 2012 Jaguar**


Actual Measured Vehicle Model: Jaguar, 2012 model, VIN= SAJAA22H9CFV\*\*\*\*\*

Operation Procedures:


1. Select the Jaguar V19.00 or above;
2. Select the Manual Select;
3. Select the F model;
4. Select the 2014-2015 (Notice: The actual measured vehicle model is 2012 model);
5. Select the turbocharging engine;
6. Select the System Select;
7. Select the PCM (Powertrain Control Module);

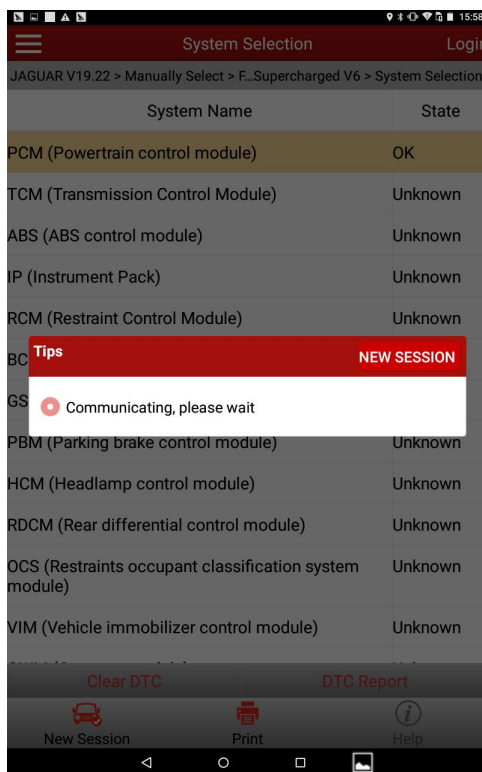


8. Select the Special Function;

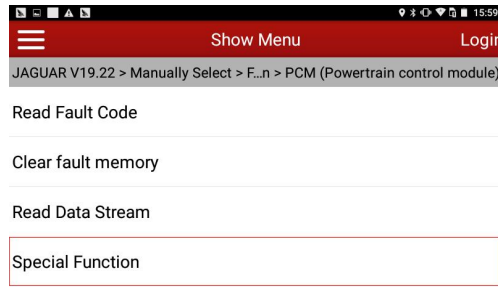


9. Select the Service Interval Reset;

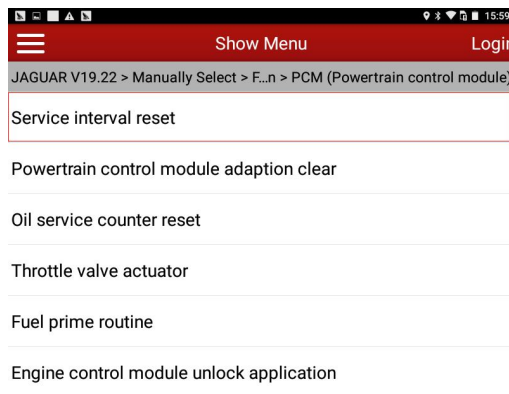


10. Turn the ignition to Position 2 as required;

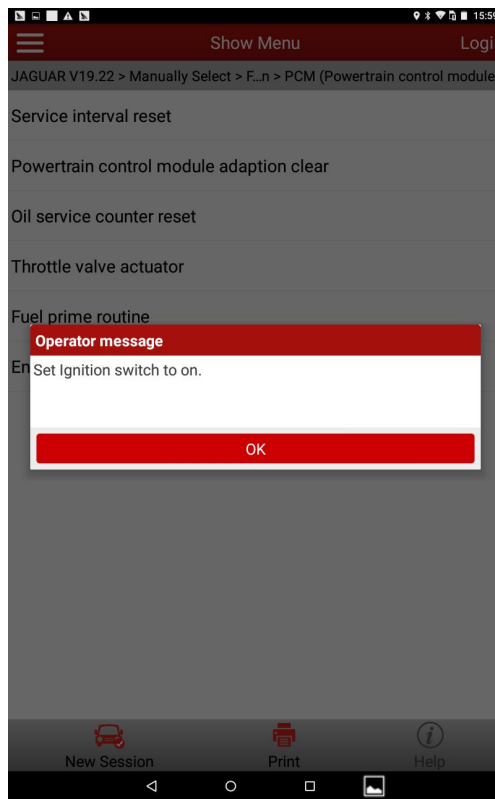


11. After the "Service Interval Reset" indicated, click Confirm;

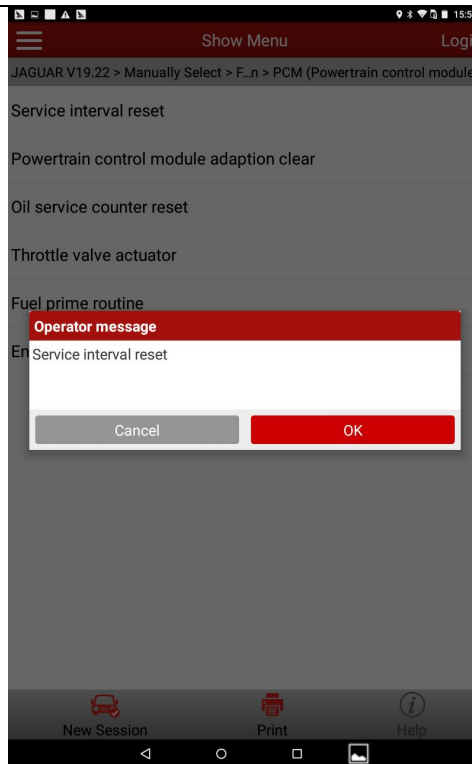


12. After the module initialized, it displays Completed;

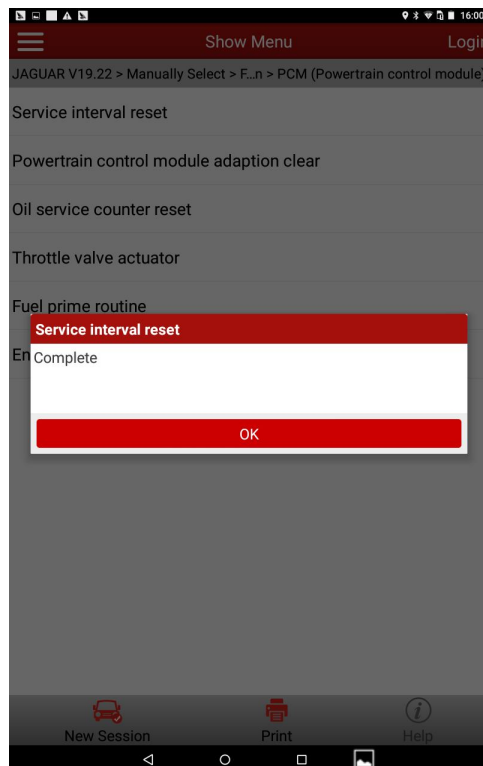

13. After "Turn the ignition off" indicated, click Confirm;

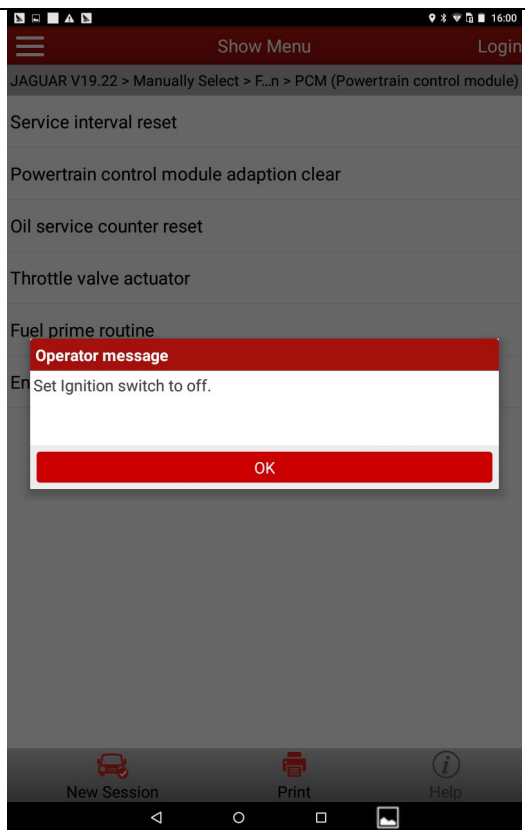

14. After the procedure successfully carried out, it indicates to clear DTCs for the vehicle, as shown in Figure 8, whether you clear DTCs or not, it does not affect the procedure execution result.

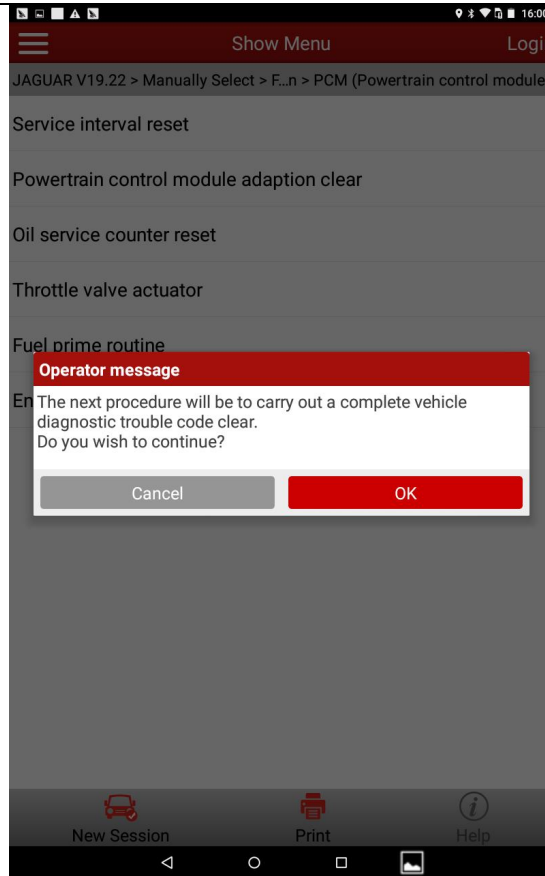

LAUNCH is dedicated to pursuing good functions and addressing customer needs. Follow LAUNCH, you will "make a little progress every day"!

